

ILS or LOC RWY 28R
CHICAGO O'HARE INTL (ORD)

MISSED APPROACH: Climb to 1100 then climbing left turn to 4000 on heading 215° and DPA VOR/DME R-082 to DPA VOR/DME and hold.




MISSED APCH FIX
DUPAGE
DPA $\ddot{=}\dot{-}$
108.4
Chan 21
8-248-068°

1100	4000	DPA	DPA
		DPA R-082	
	hdg 215°		


VGSI and ILS glidepath not coincident
(VGSI Angle 3.00/TCH 70).

	* LOC only.
--	-------------

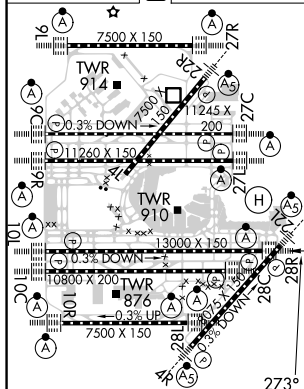

HIRL all Rwy's	
TDZ/CL all Rwy's except 4L	
	FAF to MAP 4.7 NM

Knots	60	90	120	150	180
Min:Sec	4:42	3:08	2:21	1:53	1:34

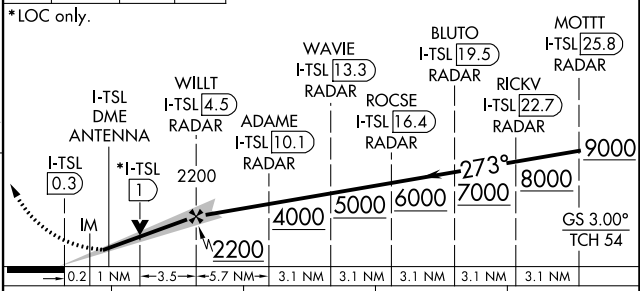

CATEGORY	A	B	C	D
S-ILS 28R	851/18 200 (200-½)			
S-LOC 28R	1120/24 469 (500-½)		1120/50 469 (500-1)	