


WAAS CH 50244 W31A	APP CRS 300°	Rwy Idg TDZE Apt Elev	8500 429 476
--	------------------------	-----------------------------	---

RNAV (GPS) Z RWY 31L

PALM SPRINGS INTL (PSP)

RNP APCH-GPS.		MISSED APPROACH: Climb to 900 then climbing right turn to 4000 direct TANFY and track 107° to BANPE and track 144° to TRM VORTAC and hold. *Missed approach requires minimum climb of 355 feet per NM to 2100.			
Circling NA southwest of Rwy 13R-31L.					
ATIS 124.65	SOCAL APP CON 126.7 370.95 135.275 251.1	PALM SPRINGS TOWER * 119.7 (CTAF) 377.05	GND CON 121.9	CLNC DEL 128.35	UNICOM 122.95

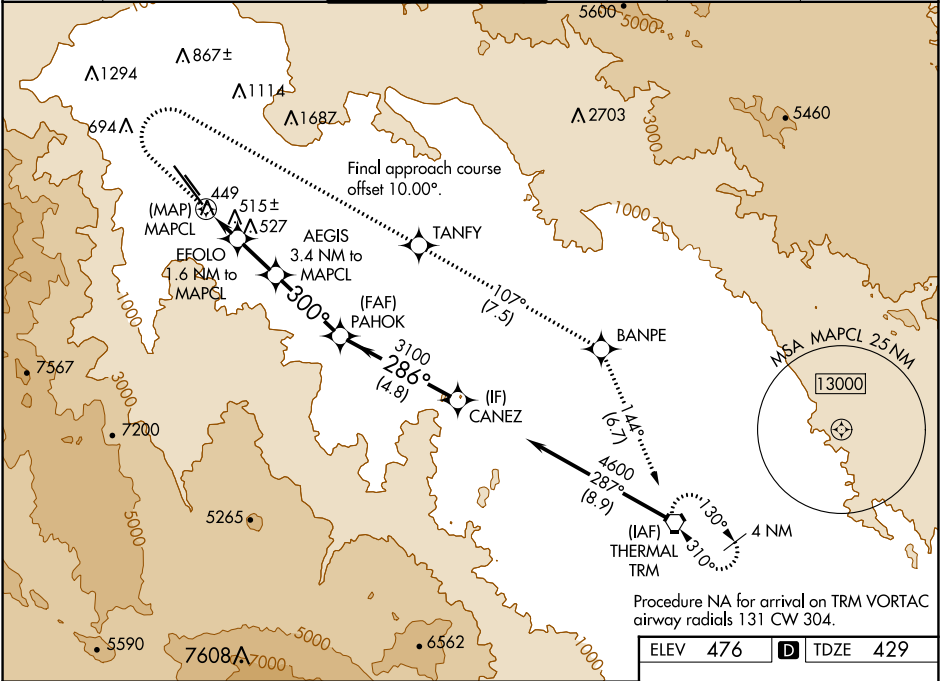

Procedure NA for arrival on TRM VORTAC
airway radials 131 CW 304.

ELEV 476	TDZE 429
----------	----------

900	4000	TANFY	tr 107°	BANPE	tr 144°	TRM
VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 55).						
		PAHOK				
		AEGIS				
		EFOLO				
		MAPCL				
		1220				
		1920				
		300°				
		3100				
		286°				
		4600				
		4.8 NM				
		3.2 NM				
		1.9 NM				
		1.6 NM				
		0.5 NM				
CATEGORY	A	B	C	D		
LP MDA	700-1 271 (300-1)	780-1 351 (400-1)	1320-2½	891 (900-2½)		
RNAV MDA*		780-1	351 (400-1)			
RNAV MDA	920-1 491 (500-1)	1180-1¼ 751 (800-1¼)	1440-3	1011 (1000-3)		
CIRCLING	920-1 444 (500-1)	1180-1¼ 704 (800-1¼)	1440-3	1760-3		

